

NOTE: 1) JUMPERS ARE PLACED ON J1 PINS 1&2, J2 PINS 4&5 FOR DRY CONTACTS ON RELAY OUTPUT #1.

2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.

3) TRANSFORMER AND BRIDGE RECTIFIER VOLT/ AMPERE RATING IS DETERMINED BY CURRENT DRAW OF ELECTRIC STRIKE.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM



100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101 EMAIL: www.beasensors.com

#### TITLE: MC-25 WITH RECEIVER, ELECTRIC STRIKE, PUSHPLATE, LOW ENERGY AUTOMATIC DOOR APPLICATION

SIZE:	DRAWN BY: KJG	REV BY: JEG	PART NO: 80.0011.02
Α	SCALE:	DATE:	SHEET
	NONE	24 APR 2005	1 OF 1



 $\Lambda$ 

CAGE CODE

NONE

A SCALE DWGNO

80.0012

DATE:

FILE OF:

02 JAN 04


ENG'G


DRAWN BY: REV

1 OF 1

01

JED

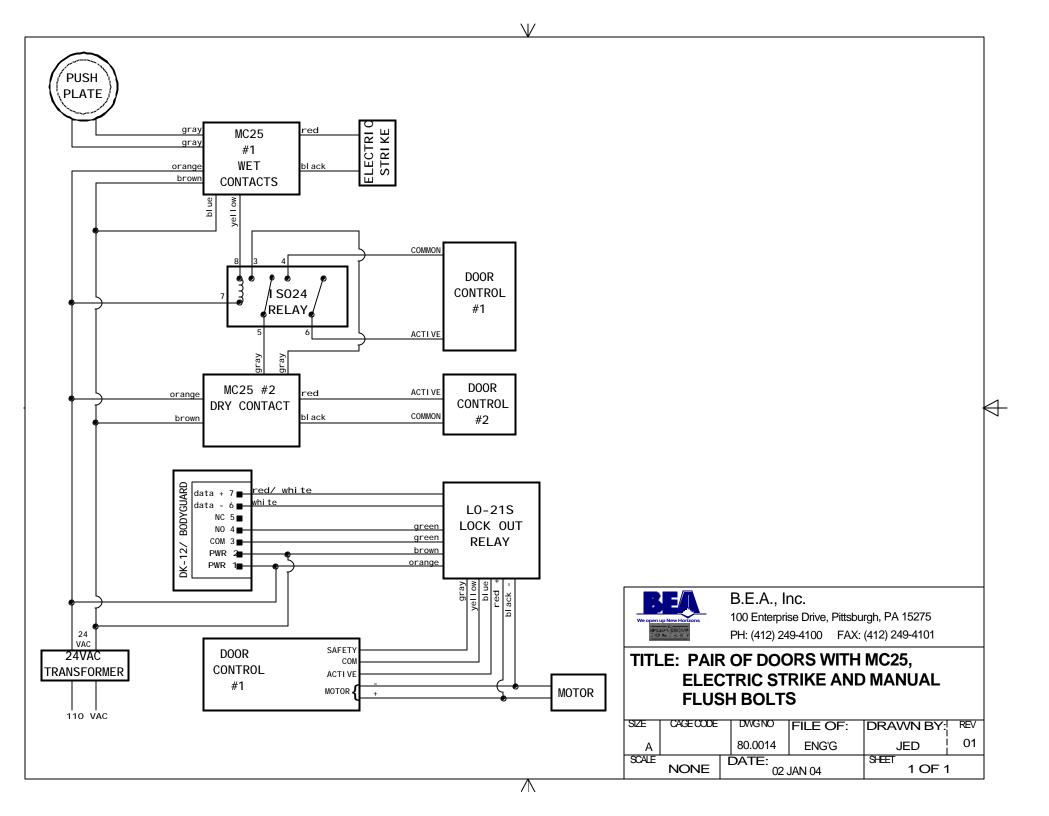

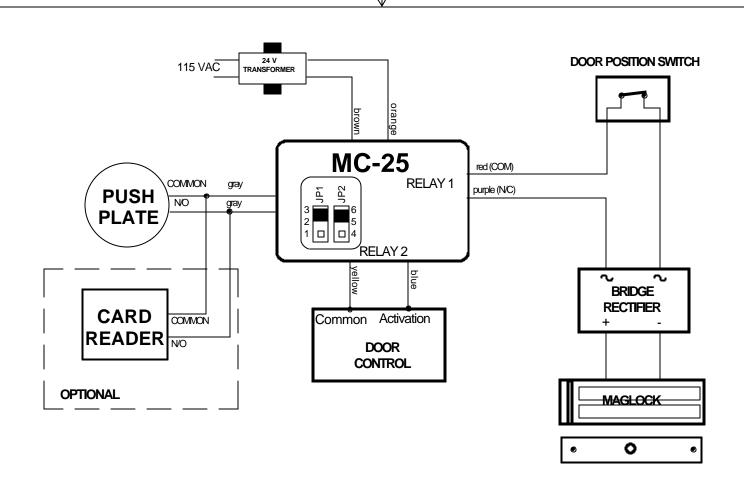

NOTES: 1) JUMPERS JP1 & JP2 ARE PLACED ON PINS 2,3 AND 5,6 FOR WET CONTACTS.

- 2) DOOR POSITION SWITCH CONTACTS CLOSED WHEN DOOR IS CLOSED.
- 3) TRANSFORMER AND BRIDGE RECTIFIER CURRENT RATING MUST BE SUFFICIENT TO SUPPORT MC-25 AND MAGLOCK.
- 4) BRIDGE RECTIFIER SUPPLIED BY OTHERS.




B.E.A., Inc.

100 Enterprise Drive, Pittsburgh, PA 15275

PH: (412) 249-4100 FAX: (412) 249-4101

### TITLE: MC-25 WITH SAME POWER SUPPLY FOR MAGLOCK

SIZE:	CAGE CODE	. I	DWG NO:	FILE OF:		DRAWN BY:	REV:
Α	002.002		80.0015	ENG'G		JED	01
SCALE	: NONE	D/	ATE: 02 J	IAN 04	SHEE	T: 10F1	

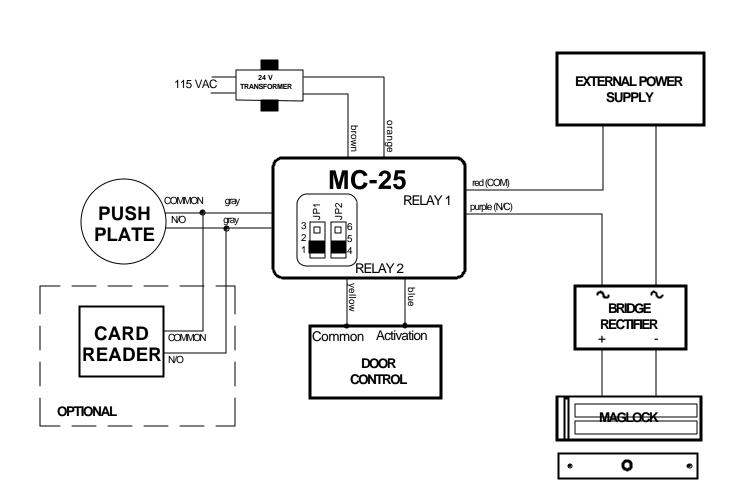

NOTES: 1) JUMPERS JP1 & JP2 ARE PLACED ON PINS 1,2 AND 4,5 FOR DRY CONTACTS.

2) BRIDGE RECTIFIER SUPPLIED BY OTHERS.




B.E.A., Inc.

100 Enterprise Drive Pittsburgh, PA 15275 PH: (412) 249-4100 FAX: (412) 249-4101

### TITLE: MC-25 WITH SEPERATE POWER SUPPLY FOR MAGLOCK

SZE:	CAGE CODE:	DWGNO:	IFILE OF:	IDRAWNBY:	RFV <sup>.</sup>
<u> </u>	G IOL GODL.	D. 1.0.1.0.	, <u></u> 01 .	DIVWINDI.	
Α		80.0017	ENG'G	JED	01
<i>,</i> ,					٥.
SCALE:		DATE:		SHEET:	
	NTS	02 JA	N 04	1 OF 1	
	1110	02 01	u v O <del> T</del>	1011	

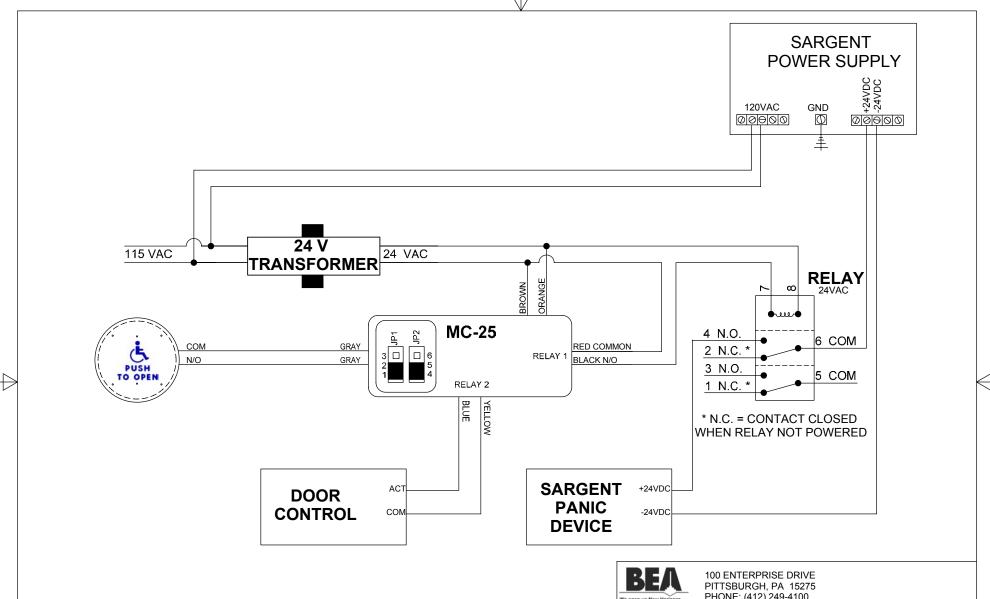


HALMA GROUP

PHONE: (412) 249-4100 FAX: (412) 249-4101 EMAIL: www.beasensors.com

#### TITLE: MC-25 w/ SARGENT EL PANIC **DEVICE & AUTOMATIC DOOR OPERATOR**

SIZE: DRAWN BY: REV BY: PART NO: 80.0018.02 KJG KJG SCALE: DATE: SHEET NONE 17 MAY 2005 1 OF 1

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM

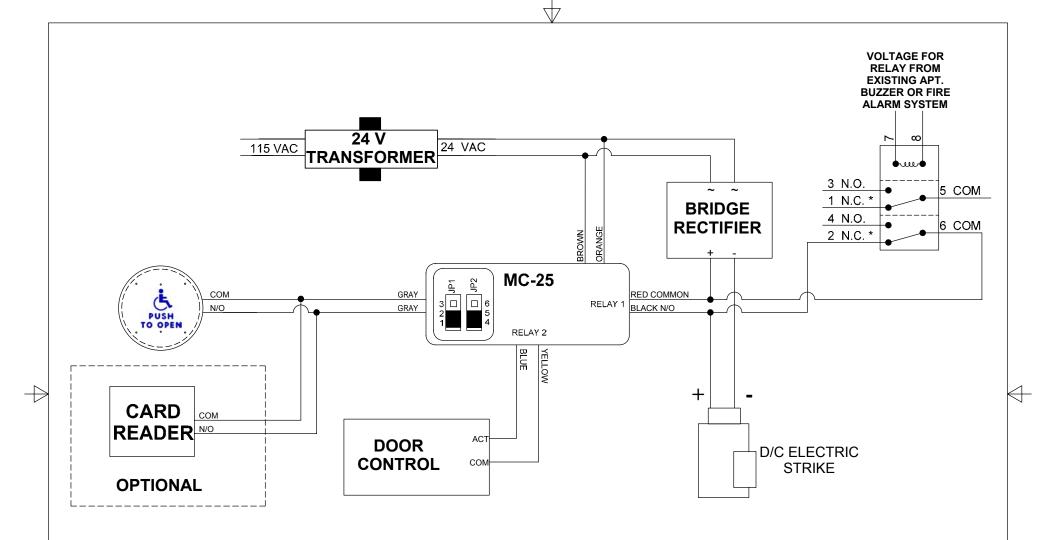



- 2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.
- 3) TRANSFORMER AND BRIDGE RECTIFIER VOLT/ AMPERE RATING IS DETERMINED BY CURRENT DRAW OF ELECTRIC STRIKE.
- 4) BRIDGE RECTIFIER SUPPLIED BY OTHERS.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM




100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101 EMAIL: www.beasensors.com

#### TITLE: MC-25 WITH ELECTRIC STRIKE, APT. BUZZER RELAY/ FIRE ALARM

SIZE:	DRAWN BY: KJG	REV BY: KJG	PART NO: 80.0019.02
Α	SCALE: NONE	DATE:	SHEET
	NONE	18 MAY 2005	1 OF 1



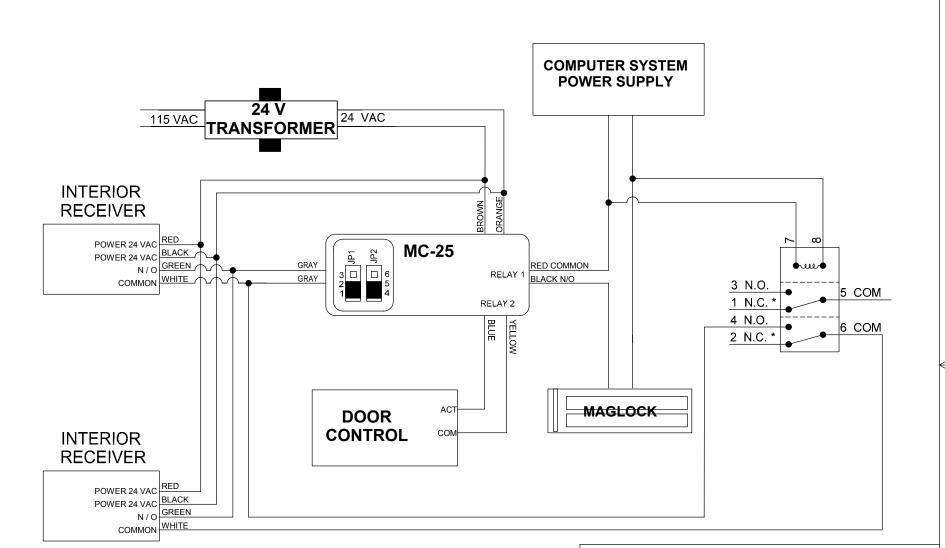

NOTES: 1) JUMPERS JP1 & JP2 ARE PLACED ON PINS 1,2 AND 4,5 FOR DRY CONTACTS.
2) TYPE OF RELAY WILL BE DETERMINED BY MAGLOCK VOLTAGE (12 OR 24 VOLTS).

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM




100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101 EMAIL: www.beasensors.com

## TITLE: MC-25 WITH RECEIVERS, SEPARATE POWER SUPPLY FOR MAGLOCK, NIGHT MODE RELAY

SIZE:	DRAWN BY: KJG	REV BY: KJG	PART NO: 80.0020.02
Α	SCALE:	DATE:	SHEET
	NONE	18 MAY 2005	1 OF 1



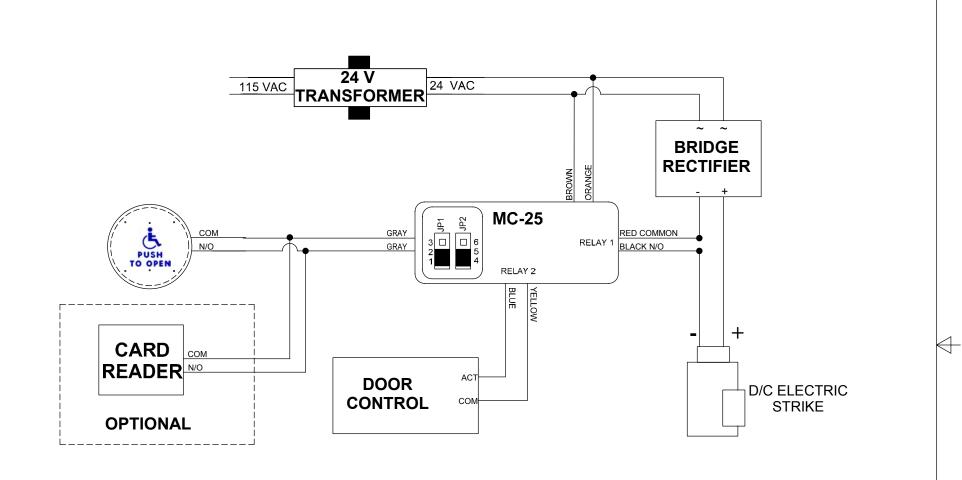

 $\triangle$ 

NOTES: 1) JUMPERS ARE PLACED ON J1 PINS 1&2, J2 PINS 4&5 FOR DRY CONTACTS ON RELAY OUTPUT #2.

2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.

3) TRANSFORMER VOLT/ AMPERE RATING IS DETERMINED BY CURRENT DRAW OF ELECTRIC STRIKE.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM




100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101


EMAIL: www.beasensors.com

#### TITLE: MC-25 WITH ELECTRIC STRIKE, **AUTOMATIC DOOR APPLICATION**

SIZE:	DRAWN BY: KJG	REV BY: KJG	PART NO: 80.0022.02
Α	SCALE:	DATE:	SHEET
	NONE	19 MAY 2005	1 OF 1



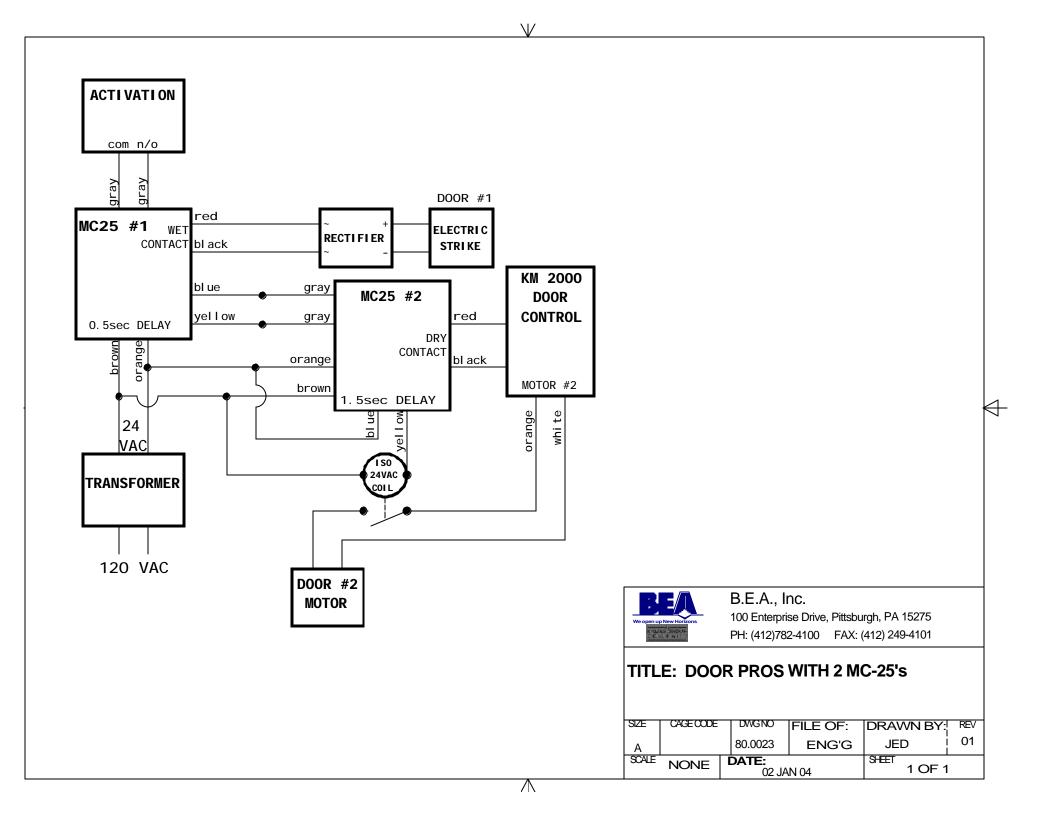

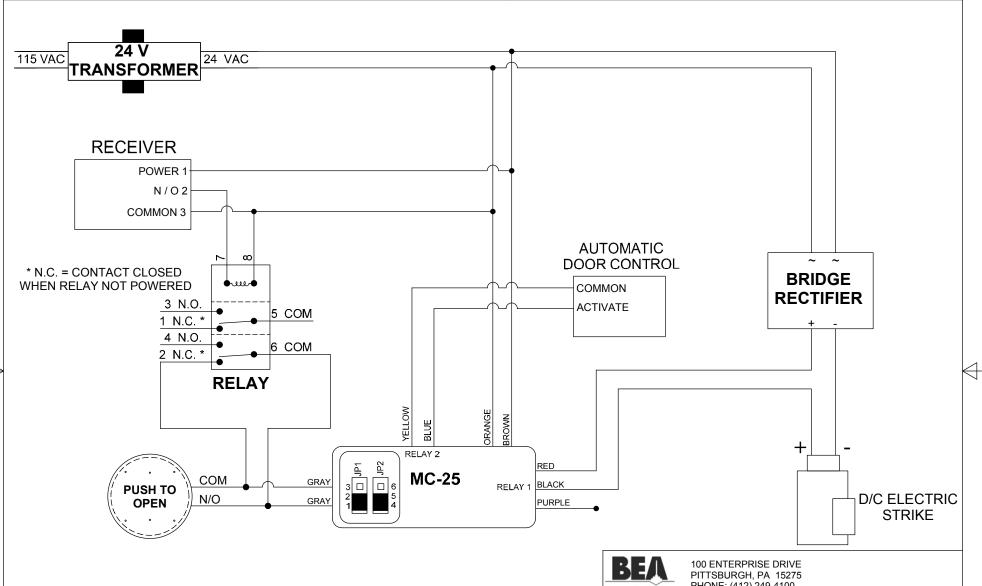

NOTES: 1) JUMPERS ARE PLACED ON J1 PINS 1&2, J2 PINS 4&5 FOR DRY CONTACTS ON RELAY OUTPUT #2.

2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.

3) TRANSFORMER AND BRIDGE RECTIFIER VOLT/ AMPERE RATING IS DETERMIND BY CURRENT DRAW OF ELECTRIC STRIKE.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM




PHONE: (412) 249-4100 FAX: (412) 249-4101 EMAIL: www.beasensors.com

#### TITLE: MC-25 WITH 3 WIRE RECEIVER, **ELECTRIC STRIKE, PUSHPLATE AUTOMATIC DOOR APPLICATION**

SIZE:	DRAWN BY: KJG	REV BY: TUC	PART NO: 80.0135.02
А	SCALE:	DATE:	SHEET
	NONE	23 NOV 2005	1 OF 1



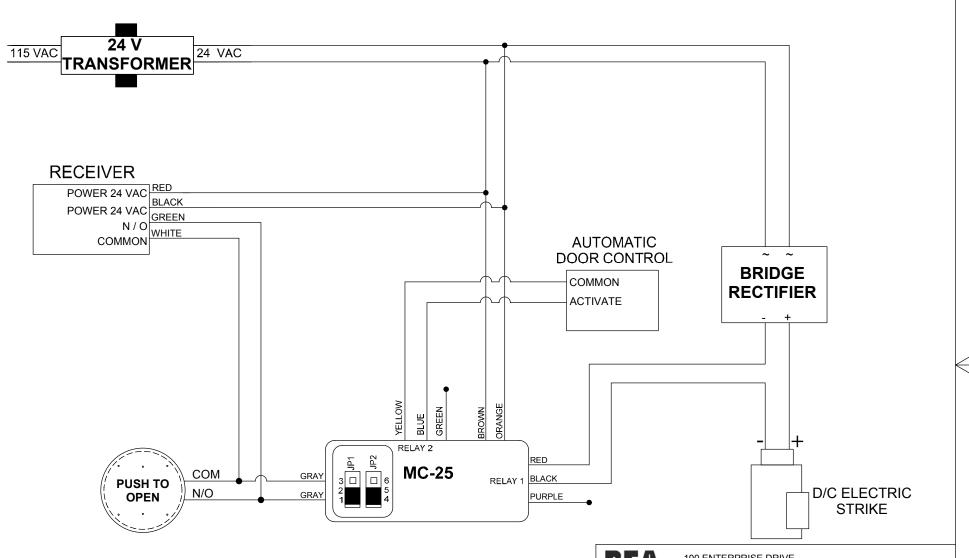

NOTES: 1) JUMPERS ARE PLACED ON J1 PINS 1&2, J2 PINS 4&5 FOR DRY CONTACTS ON RELAY OUTPUT #2.

2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.

3) TRANSFORMER AND BRIDGE RECTIFIER VOLT/ AMPERE RATING IS DETERMIND BY CURRENT DRAW OF ELECTRIC STRIKE.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM, FOR AFTER-HOURS. CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM




100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101


EMAIL: www.beasensors.com

#### **TITLE: MC-25 WITH RECEIVER, ELECTRIC** STRIKE, PUSHPLATE AUTOMATIC **DOOR APPLICATION**

SIZE:	DRAWN BY: KJG	REV BY: TUC	PART NO: 80.0138.02
Α	SCALE:	DATE:	SHEET
	NONE	23 NOV 2005	1 OF 1



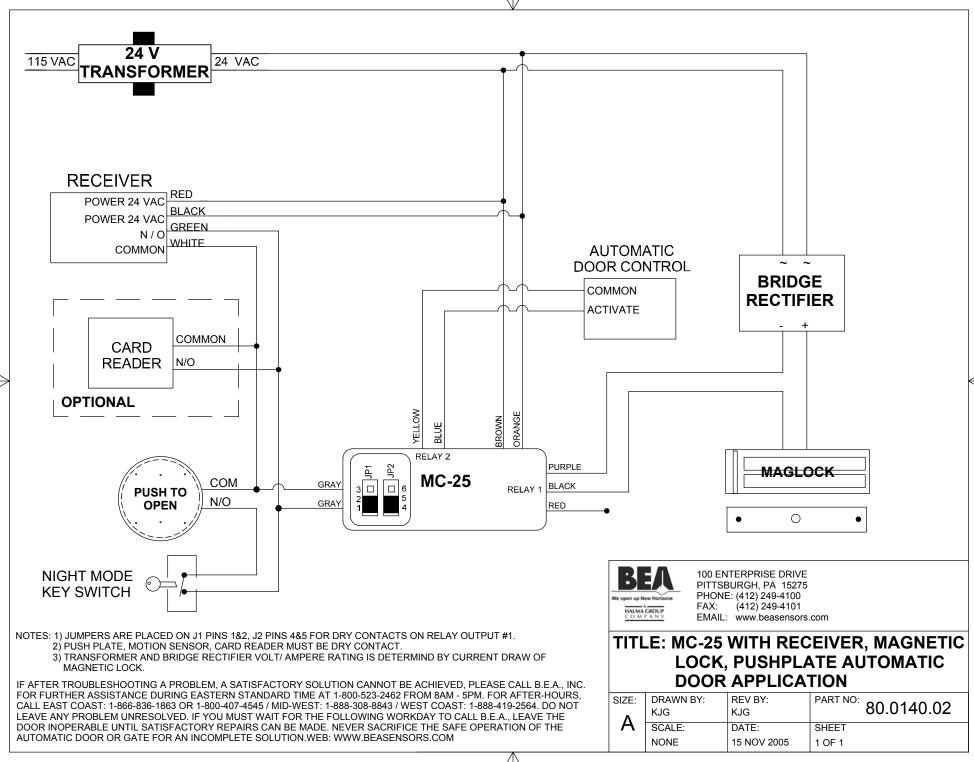

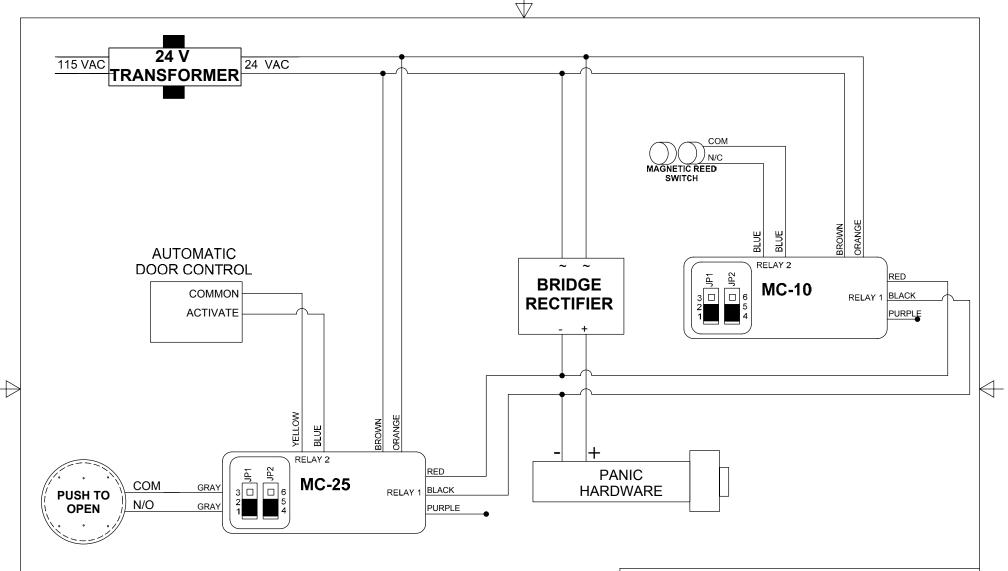

NOTES: 1) JUMPERS ARE PLACED ON J1 PINS 1&2, J2 PINS 4&5 FOR DRY CONTACTS ON RELAY OUTPUT #1.

- 2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.
- 3) TRANSFORMER AND BRIDGE RECTIFIER VOLT/ AMPERE RATING IS DETERMIND BY CURRENT DRAW OF ELECTRIC PANIC.
- 4) MAGNETIC REED SWITCH MUST BE CLOSED WHILE DOOR IS OPEN.
- 5) SET MC-10 TIME DELAY FOR THE LENGTH OF TIME TO KEEP PANIC UNLOCKED ONCE CLOSED. IF PANIC CURRENT LOAD IS GREATER THAN 500 mA, AN AUXILLARY RELAY MUST BE USED. PLEASE CONTACT BEA TECHNICAL SERVICES FOR MORE INFORMATION.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM




100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101 EMAIL: www.beasensors.com

# TITLE: MC-25 WITH ELECTRIC PANIC, PUSHPLATE AUTOMATIC DOOR APPLICATION

SIZE:	DRAWN BY: KJG	REV BY: JDC	PART NO: 80.0142.02
Α	SCALE:	DATE:	SHEET
	NONE	20 MARCH 2006	1 OF 1



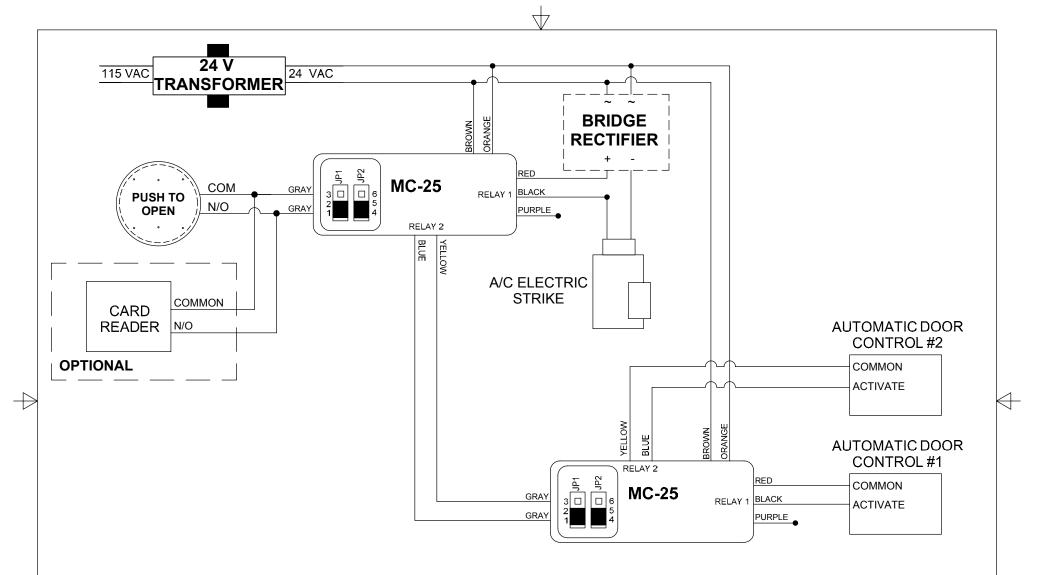



2) PUSH PLATE, MOTION SENSOR, CARD READER MUST BE DRY CONTACT.

3) TRANSFORMER VOLT/ AMPERE RATING IS DETERMIND BY CURRENT DRAW OF ELECTRIC STRIKE.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM



100 ENTERPRISE DRIVE PITTSBURGH, PA 15275 PHONE: (412) 249-4100 FAX: (412) 249-4101

EMAIL: www.beasensors.com

#### TITLE: 2 MC-25s WITH ELECTRIC STRIKE, **SEQUENCING 2 DOOR PANELS**

SIZE:	DRAWN BY: KJG	REV BY: KJG	PART NO: 80.0147.02
А	SCALE:	DATE:	SHEET
	NONE	16 NOV 2005	1 OF 1



